The second second

OUT60227


1966 CCT 27 20

P 272015Z QCT 66
FM NPIC WASHDC
TO RUCSAAA/SAC OFFUTT AFB OMAHA NEB
RUCVAAA/4080 STRAT WG OL 19 BARKSDALE AFB LA
RUCVAAA/2D RTS BARKSDALE AFB LA
RUEKDA/DIA WASHDC
RUECYH/NAVRECONTECHSUPPCEN SUITLAND MD
RUEPIA/CIA WASHDC
RUWBKN/15TH AF MARCH AFB RIVERSIDE CALIF
RUCVAAA/2 AF BARKSDALE AFB LA
BT
S E C R E T CITE NPIC 8891.

15TH AF (FOR DI), SAC (FOR DIM/GLASS LAMP/DOCR, DM 4)
2D AF (FOR DI).

- 1. CAMERA B-23 WAS USED IN MISSION G-919 FLOWN ON 24 OCTOBER 1966. PROCESSING WAS ACCOMPLISHED BY NRTS.
 - 2. ORIGINAL NEGATIVE:
- A. EXPOSURE WAS ADEQUATE THROUGHOUT THE MISSION AND THE RESOLUTION IS GOOD.
- B. 9R SIDE: EDGE STATIC IS PRESENT ON BOTH EDGES OF THE FILM THROUGHOUT THE MISSION. EDGE FOG WAS ONLY NOTED INTERMITTENTLY ON THE OUTBOARD EDGE. ROLLER CHATTER IS PRESENT ALONG THE INBOARD EDGE THROUGHOUT. THERE ARE LIGHT LEAKS IN FRAMES 304, 1273 AND 2027. THERE ARE MANY PLUS DENSITY STREAKS NOTED THROUGHOUT THE MISSION. THEY ARE MORE DETECTABLE OVER LIGHT DENSITY AREAS PARTICULARLY OVER WATER. THERE IS A HEAT SPLICE IN FRAME 1060.

 A MANUFACTURING SPLICE IS LOCATED IN FRAME 332. A FOGGED IMPRINT

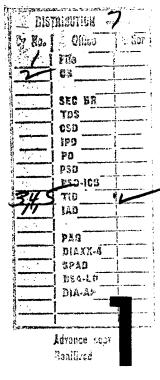

26×ZOCT 1966

一フー

FROM THIS SPLICE WAS NOTED IN FRAMES 331-333.

- C. 9L SIDE: EDGE STATIC IS PRESENT FROM HEAD TO TAIL IN THE MISSION. MINOR ROLLER CHATTER IS NOTED ALONG BOTH EDGES.

 THERE ARE MANY PLUS DENSITY LINES STARTING ON FRAME 939 AND CONTINUING THROUGHOUT THE MISSION. HEAT SPLICES ARE NOTED BETWEEN FRAMES 299/300, 927/928, 936/937 AND THROUGH FRAME 911. A MANUFACTURING SPLICE IS LOCATED IN FRAME 251.
 - D. THE LAST TITLED FRAME OF THE MISSION IS 2088.
 - E. THERE WERE NO MAJOR CAMERA OR PROCESSING MALFUNCTIONS.
 - 3. POSITIVE
 - A. P.I. SUITABILITY IS GOOD.
 - B. PRINTING AND PROCESSING WERE GOOD.
- C. CLOUDS OBSCURE APPROXIMATELY 20 PERCENT OF THE MISSION.
 GP-1.

SECRET

-END OF MESSAGE-